
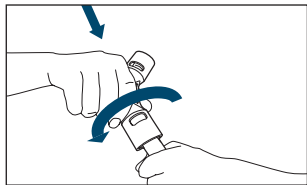
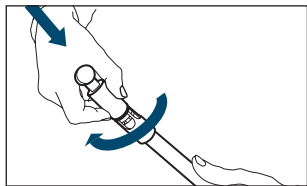
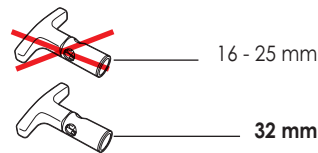
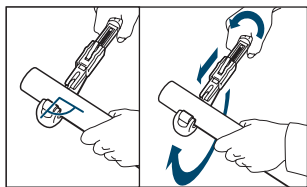




Montage G2 Press-Fitting
Mounting G2 press-fittings
Montage des raccords à sertir G2
Montage G2 pers-fittingen

16 - 32 mm
U/TH/H/RFz-Kontur/contour







Ablängen
Cutting
Couper
Knippen

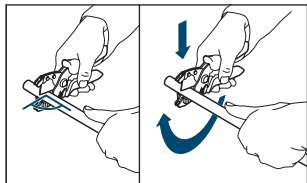



Sichtkontrolle
Visual inspection
Contrôle visuel
Visuele inspectie

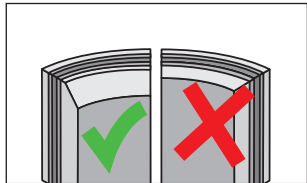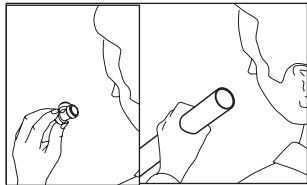

Pressen
Pressing
Sertir
Persen

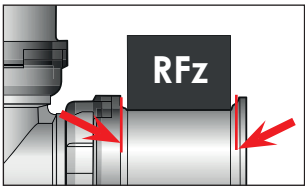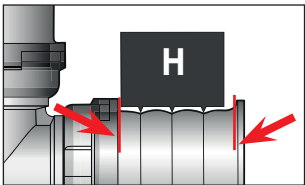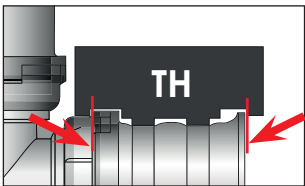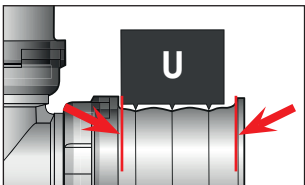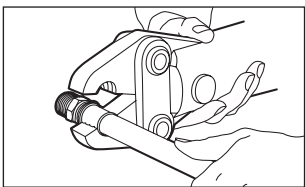
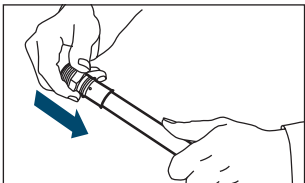


U-Kontur, Pressmaße
U contour, pressing measures
Contour U, cote de pressage
U contour, persafmeting

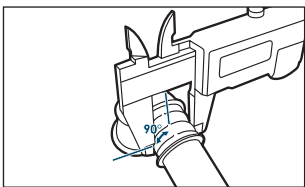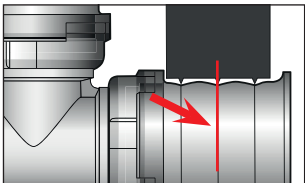



Ø 16 / min/max: 16,0 - 16,3 mm
Ø 20 / min/max: 20,0 - 20,3 mm
Ø 25 / min/max: 25,0 - 25,3 mm
Ø 32 / min/max: 32,0 - 32,3 mm

H-Kontur, Pressmaße
H contour, pressing measures
Contour H, cote de pressage
H contour, persafmeting

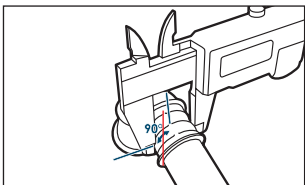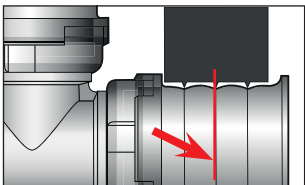



Ø 16 / min/max: 16,0 - 16,3 mm
Ø 20 / min/max: 20,0 - 20,3 mm
Ø 25 / min/max: 25,0 - 25,3 mm
Ø 32 / min/max: 32,0 - 32,3 mm

TH-Kontur, Pressmaße
TH contour, pressing measures
Contour TH, cote de pressage
TH contour, persafmeting

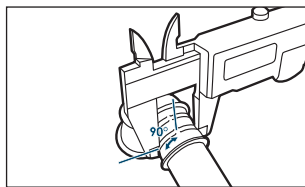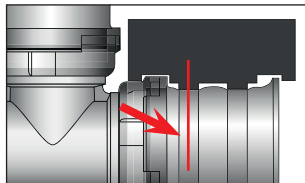

Ø 16 / min/max: 16,5 - 16,7 mm
Ø 20 / min/max: 20,5 - 20,7 mm
Ø 25 / min/max: 25,3 - 25,5 mm
Ø 32 / min/max: 32,3 - 32,5 mm

RFz-Kontur, Pressmaße
RFz contour, pressing measures
Contour RFz, cote de pressage
RFz contour, persafmeting

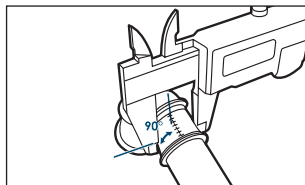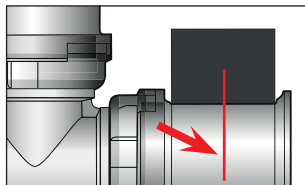

Ø 16 / min/max: 16,5 - 16,7 mm
Ø 20 / min/max: 20,6 - 20,8 mm
Ø 25 / min/max: 25,6 - 25,8 mm
Ø 32 / min/max: 32,6 - 32,8 mm



Montage/Mounting/Montage des raccords/Montage ->



>>>



>>>



>>>



>>>